




Skruvskarvhylsor

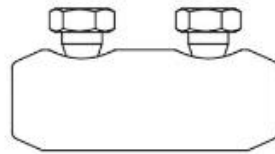

25 - 95mm²
35 - 150mm²

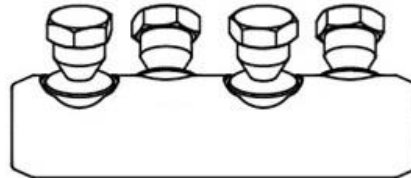

70 - 240mm²
120 - 300mm²

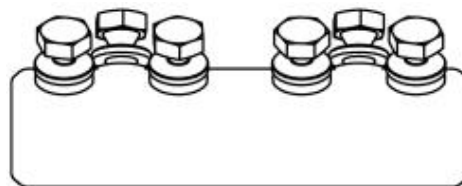


185 - 400mm²
300 - 630mm²

*Denna kontakt är tillämpbar för angivna tvärsnitt för klass 1 och 2 ledare enligt DIN EN/IEC 60228.


Area							
mm ²	AL-CU mm ²	AL-CU mm ²	mm	mm ²	mm ²	Pc.	SW mm
25 - 95	25 - 95	25 - 70	35	25 - 50	70 - 95	2	13
35 - 150	35 - 150	35 - 120	40	35 - 70	95 - 150	2	17
70 - 240	70 - 240	70 - 185	65	70 - 120	150 - 240	4	19
120 - 300	120 - 300	120 - 240	70	120 - 185	240 - 300	4	22
185 - 400	185 - 400	185 - 300	85	185 - 240	300 - 400	6	22
300 - 630	300 - 630	300 - 500	100	300 - 400	500 - 630	6	24

1.

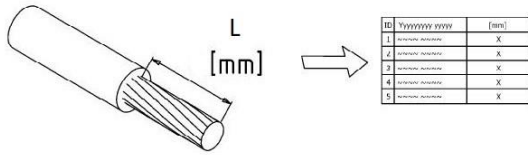


- Ta bort isoleringen över ledaren enligt bild

2.

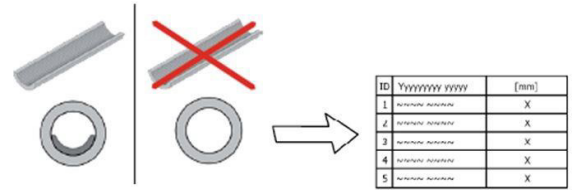


- Ta bort insättning vid större ledarareor, se tabell.

3.

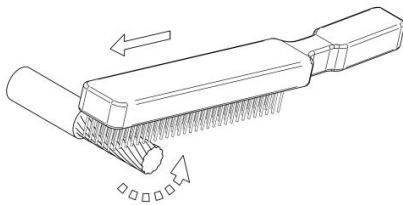


- Ta bort oxidskiktet

4.

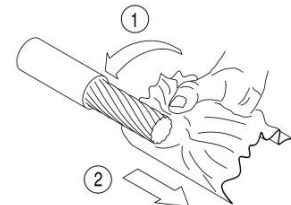


- Rengör ledaren

5.

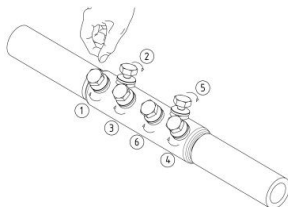


- Dra åt skruvarna för hand

6.

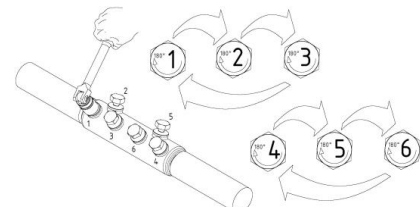


- Dra därefter åt skruvarna växelvis med ett lämpligt verktyg tills skruvskallen bryts av

7.

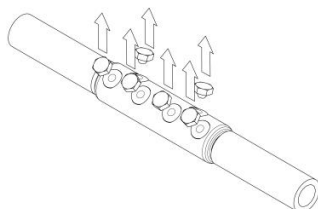

- Ta bort bulthuvudena

8.

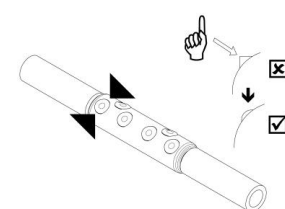

- Runda skarpa kanter